

ADA Compliance Program

Clark County Facilities Transition Plan Public Service Center

Date of Survey: May 9, 2006

Conducted by: Wayne Yarnall Jesse Magana Teresa Guise Tim McVicker



Item #

Issue: Maneuvering Clearances at Manual Swinging Doors

Issue:

Location: The following restroom doors do not meet this requirement. The

required space on all doors is obstructed by the waste containers.

Most doors measure 14 inches of clearance.

1st Floor Women's Restroom in Lobby

2nd Floor Women's and Men's Restroom in Lobby
 3rd Floor Women's and Men's Restroom in Lobby
 4th Floor Women's and Men's Restroom in Lobby
 5th Floor Women's and Men's Restroom in Lobby

Code: ANSI Table 404.2.3.1 On the approach direction from front pull

manual swinging doors there must be 18 inches of clear space

parallel to the doorway (beyond the latch)

Notes: Move trash containers to a distance of 18 inches from the door

frame



Item # 2

Issue: Vertical Grab Bars

Issue:

Location: All Accessible Restroom Stalls

Code: ANSI 604.51. Fixed Side wall Grab Bars – (States in part) ... A

vertical grab bar 18 inches minimum in length shall be mounted with the bottom of the bar located 39 inches and 41 inches above the floor, and with the center line of the bar located between 39"

and 41 inches from the rear wall.



ADA Compliance Program

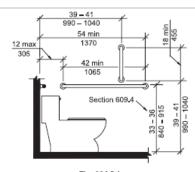


Fig. 604.5.1 Side Wall Grab Bar for Water Closet

Notes: All accessible restroom stalls need to have vertical grab bars

installed.



Item # 3

Issue: Automatic Door

Issue:

Location: West Lobby -1st Floor

Code:

Notes: Recommendation:

Though not required, it is recommended that an automatic door be installed on the first floor east end lobby. The exterior door is automatic but the second door at the foot of the stairwell is not.



Item # 4

Issue: Emergency Intercoms in Evacuation Refuge Areas – No operation

instruction in Braille.

Issue: ANSI 703.4.4 Position - Braille shall be below the corresponding

text.

Recommendation:

Location:

Al Floors with Intercoms

Code:

Notes:



ADA Compliance Program



Item # 5

Issue: No operation instruction in Braille for ATM machine

Issue:

Location: Second Floor – Auditor's Office Lobby

Code: ANSI 703.4.4 Position - Braille shall be below the corresponding

text.

6

Notes: Acquire signs for operation of ATM in Braille.



Item #

Issue: Handrails need on both sides of stairs and ramp

Issue:

Location: Room 185 - Entrance

Code: ANSI 505.2 Location – Handrails shall be provided on both sides of

stairs and ramps.



Notes:

No Photo Item #

Issue: Construct ramp on West end of Covered Walkway

Issue:

Location: Covered Walkway

Code:

Notes: This is a hazardous area and does not provide the service of a

covered walkway for individuals in mobility devices.